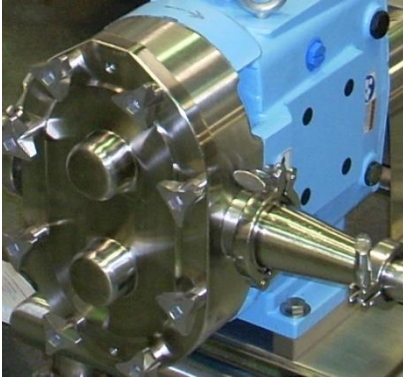
	Preventive Maintenance SOP	Doc. No.	128.01.003
	Rotary Pump Annual Maintenance	Version Number	15 Jan 2019 v1
		Page	1 of 5

Purpose: To perform an inspection and oil change of the slurry system rotary pumps.



Required PPE:



Safety Glasses



Hearing Protection



Steel Toed Shoes



Nitrile Gloves

Potential Hazards:



The slurry pumps have rotating components. Keep hands clear unless the unit is off and locked out and tagged out.



Electrical shock hazards exist when working on these pumps. Be sure the pump motor is locked out and tagged out before performing maintenance on this equipment.




The slurry pumps have hot surfaces, which could cause severe burns. Avoid contact with these hot surfaces.

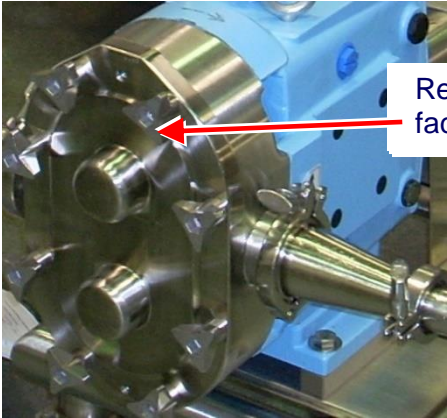
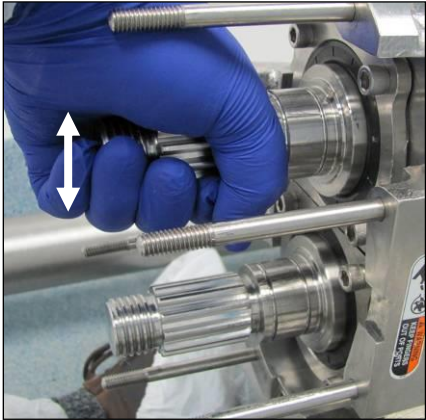
Reference Documents: None


Required Equipment & Materials:



- Standard preventive maintenance tool kit
- Rags for cleaning
- FMO 1100 AW Gear Oil
- Catch pan for oil
- Oil funnel


SAMPLE PROCEDURE ONLY – DO NOT USE FOR EQUIPMENT OPERATION			
<table border="0" style="width: 100%;"> <tr> <td style="width: 33%; text-align: left;">www.aps-online.net</td> <td style="width: 33%; text-align: center;">Applied Performance Strategies, Inc.</td> <td style="width: 33%; text-align: right;">(610) 987-4050</td> </tr> </table>	www.aps-online.net	Applied Performance Strategies, Inc.	(610) 987-4050
www.aps-online.net	Applied Performance Strategies, Inc.	(610) 987-4050	

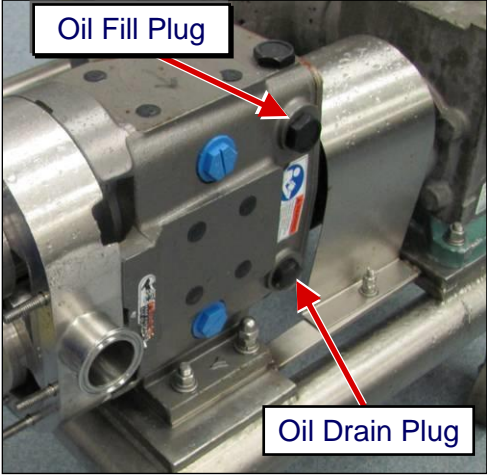
	Preventive Maintenance SOP	Doc. No.	128.01.003
	Rotary Pump Annual Maintenance	Version Number	15 Jan 2019 v1
		Page	2 of 5

Steps	Awareness
Prepare the Pump for Inspection	
1. Remove the pump's face plate.	
Inspect Pump Shafts Bearings	
1. Grasp the pump shaft and apply an upward and downward force of about 30 pounds.	 <p style="text-align: center;">Check for Shaft Movement</p>
2. Check that there is no detectible shaft movement.	Detectible shaft movement is an indication of a failing bearing.
3. Repeat inspection for the other shaft.	

	Preventive Maintenance SOP	Doc. No.	128.01.003
	Rotary Pump Annual Maintenance	Version Number	15 Jan 2019 v1
		Page	3 of 5

Steps	Awareness
Inspect the Pump Gears	
1. Grasp the pump shaft and attempt to rotate it in a clockwise direction.	 <p style="text-align: center;">Check for Gear Backlash</p>
2. Check that the shaft will not rotate without transmitting motion to the other shaft.	Detectable shaft rotation indicates gear backlash which can be caused by worn gears or gears loose on shaft.
3. Repeat inspection for the other shaft.	
Inspect the Mechanical Seals	
1. If applicable, obtain and inspect the chrome oxide mechanical seal for: <ul style="list-style-type: none"> • Cracks • Chips • Scratches • Grooves 	 <p style="text-align: center;">Inspect Chrome Oxide Mechanical Seal</p>

	Preventive Maintenance SOP	Doc. No.	128.01.003
	Rotary Pump Annual Maintenance	Version Number	15 Jan 2019 v1
		Page	4 of 5

Steps	Awareness
Change the Gearbox Oil	
1. Inspect the gearbox case for any sign of oil leaks.	
2. Drain oil from the gearbox as follows: <ol style="list-style-type: none"> a. Remove the oil fill plug from the gearbox. b. Place a container under the oil drain plug. c. Slowly remove the oil drain plug and allow the gearbox to completely drain. d. Replace and tighten the oil drain plug. 	 <p style="text-align: center;">Change Gearbox Oil</p>
3. Add Bel-Ray No-Tox 90/140 Gear Oil to the gearbox through the fill opening. See chart at right for oil capacities.	Pump Oil Capacities <ul style="list-style-type: none"> • Model 15 1.3 ounces • Model 30 2.0 ounces • Model 60 6.0 ounces • Model 130 6.0 ounces
4. Replace and tighten the oil fill plug.	
5. Clean up any oil spillage.	
6. Dispose of used oil properly.	



Preventive Maintenance SOP

Doc. No. 128.01.003

Rotary Pump Annual Maintenance

Version Number 15 Jan 2019 v1

Page 5 of 5

History of Revisions

Revision Number	Revision Date	Revised By	Reason for Revision
V1	15 Jan 19	M. Smith	Included review comments.